



**Firmware Version:** 1.15rc049

**Published Date:** 2012/08/31

---

**Content:**

Upgrading Instructions:.....	2
Upgrading by using Web-UI.....	2
New Features:.....	2
Changes of MIB & D-View Module:.....	2
Problems Fixed: .....	3
Known Issues: .....	3
Related Documentation: .....	3

## Revision History and System Requirement:

Firmware Version	Date	Model	Hardware Version
1.11rc040	2012/04/23	DAP-2690	A1


## Upgrading Instructions:

D-Link AP supports firmware upgrading via Web-UI. You may download the firmware from D-Link web site <http://tsd.dlink.com.tw>.

### Upgrading by using Web-UI

1. Connect a work station to the LAN port of Access Point.
2. Open the web browser of work station and entering the IP address of the AP. The system default IP address is 192.168.0.50.
3. Enter administrator's username and password, user name is "admin" and leave the password field blank by default.

To update the AP's firmware, click **Maintenance > Firmware and SSL Certification Upload**

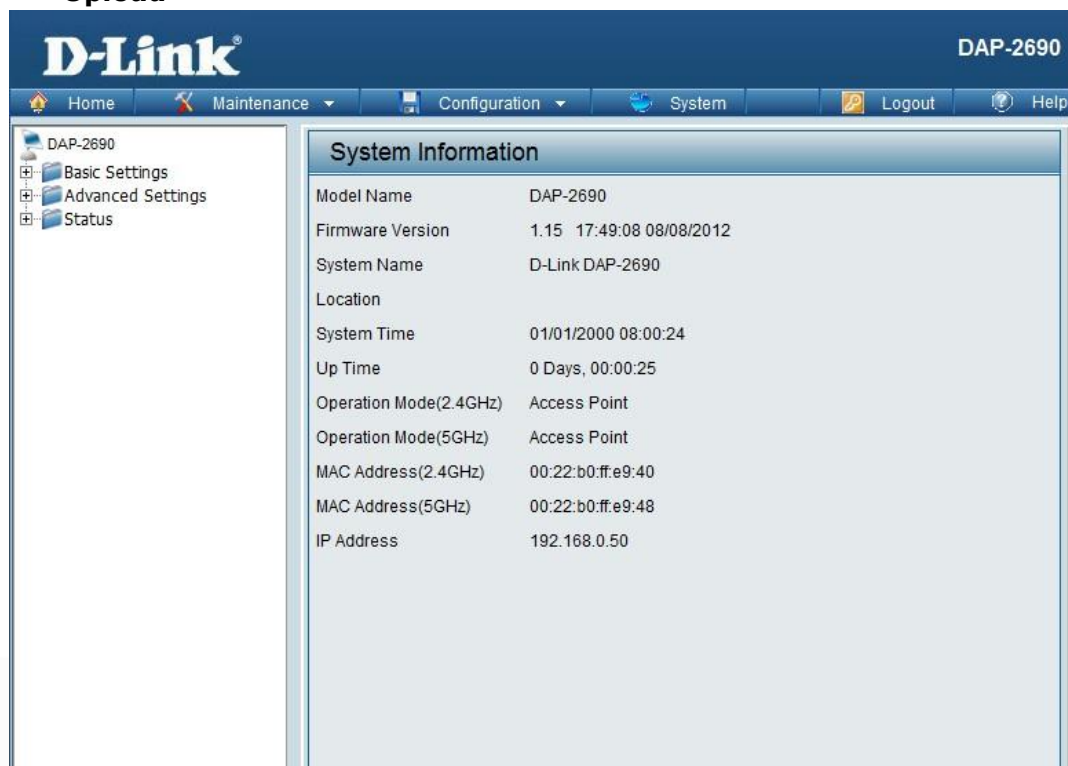

The screenshot displays the 'System Information' section of the D-Link DAP-2690 web interface. The interface includes a navigation menu on the left with options like 'Basic Settings', 'Advanced Settings', and 'Status'. The main content area lists the following system parameters:

- Model Name: DAP-2690
- Firmware Version: 1.15 17:49:08 08/08/2012
- System Name: D-Link DAP-2690
- Location: (blank)
- System Time: 01/01/2000 08:00:24
- Up Time: 0 Days, 00:00:25
- Operation Mode(2.4GHz): Access Point
- Operation Mode(5GHz): Access Point
- MAC Address(2.4GHz): 00:22:b0:ff:e9:40
- MAC Address(5GHz): 00:22:b0:ff:e9:48
- IP Address: 192.168.0.50

## New Features:

1. Enable ht20/40 coexistence in 2.4Ghz
2. Support DNS client for SNTP

## Changes of MIB & D-View Module:

None

## Problems Fixed:

Firmware Version	Problems Fixed
V1.15	<ol style="list-style-type: none"> <li>1. Fix the stuck beacon issue by chipset vender's patch</li> <li>2. Replace the IP address to domain name in Log setting</li> <li>3. Add MIB support for HT20/40 coexistence and DNS, SNTP, Log settings</li> <li>4. Fix some authentication can not support short GI</li> <li>5. Fix the ping packet will be drop when packet size larger than 1469 in WDS mode</li> <li>6. Fix VLAN only can add 15 entries.</li> <li>7. Fix AP Array slave or backup master can't Synchronized with the master.</li> </ol>

## Known Issues:

Firmware Version	Known Issues
V1.15	None

## Related Documentation:

- DAP-2690 User Manual v1.15